

Issued by
Haldex Brake Products AB

Introduction from serial No.
All ModulT ADB

Date
August 22, 2018

Product affected
ModulT ADB

P/B No
045L


Title / Subject
WARNING: Hazardous, unauthorized brake pads

Reg No.
HDX1-59-1061

Edition / Ref. No.
1.0

Page
1/1

WARNING - Unauthorized Hazardous Brake Pads in Circulation

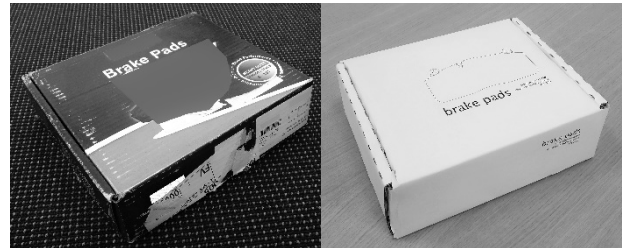

Unauthorized spare part brake pads for the Haldex ModulT disc brake, sold under the name Haldex DBT 22 LT and SBS2220 by SAF Holland, have been found in the market. These copies have larger holes in the backing plate of the brake pads, see Fig. 1 below, and do not provide the required amount of support to the projections on the thrust plate and whole mechanism as Haldex genuine spare parts.

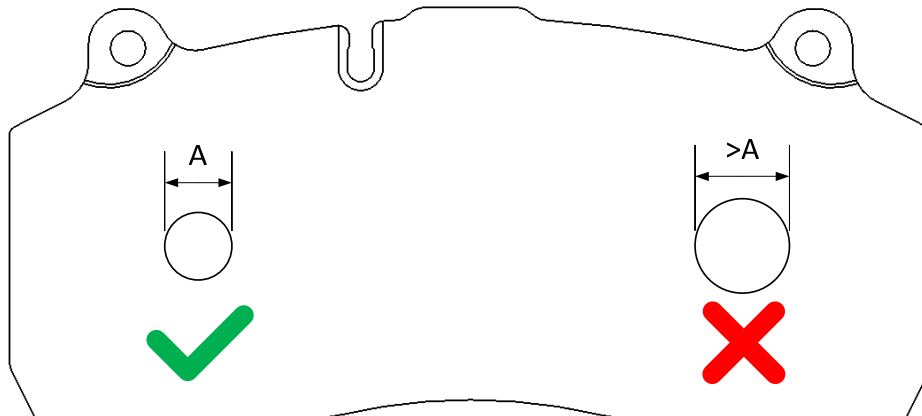


Fig. 1: A brake pad for the ModulT air disc brake is shown above. In the brake pad, the standard hole size is depicted to the left, and the enlarged hole is shown to the right.

Haldex ModulT disc brakes equipped with unauthorized brake pads have in tests shown the acceleration of the thrust plate to be significantly higher, and have been found in failed brakes having broken follower pins. This can cause the disc brake to lose the ability to brake! If non-validated spare parts are fitted, this not only invalidates any product warranty but also jeopardises the safe operational function of the brake. You can contact the Haldex Technical Support if you have any questions, see the Haldex website (<https://www.haldex.com/en/Europe/services-and-support/distributor-and-service-center-search/>).

Do not hesitate to contact Haldex should you be concerned about this issue or require further information. Haldex can also assist to ensure your vehicles are fitted with the correctly validated spare parts to ensure continual safe brake function operation.